

Monday, October 28, 2002

TECHNICAL BULLETIN

IMPROPER OPERATION – ACTION REQUIRED

SUBJECT: CAR DOOR REVERSING DEVICE

EQUIPMENT: PEELLE CAR DOORS WITH LIGHT CURTAIN REVERSING DEVICE
(PEELLE PART NUMBERS 4690 AND 4691)

DESCRIPTION: PEELLE HAS DISCOVERED THAT A NUMBER OF LIGHT CURTAINS WERE SENT OUT INCORRECTLY ADJUSTED. THE INCORRECT ADJUSTMENT IS IN THE FORM OF DIP SWITCH PLACEMENT IN THE RECEIVER. THE INCORRECT DIP SWITCH PLACEMENT REDUCES THE SENSITIVITY OF THE SYSTEM AND WILL REQUIRE ADJUSTMENT TO FUNCTION AT OPTIMAL SENSING RANGE (SEE BELOW).

ACTION: ENSURE BOTH DIP SWITCHES ARE SET TO THE “ON” POSITION (PUSHED TO THE LEFT). THE DIP SWITCHES CAN BE FOUND AT THE TOP OF THE LIGHT CURTAIN RECEIVER ON THE LEFT HAND CAR DOOR RAIL (VIEWED FROM INSIDE THE CAR LOOKING OUT).

PEELLE HELP: SHOULD YOU REQUIRE TECHNICAL ASSISTANCE, PLEASE CALL JOSE VILCHEZ AT (905) 846-4545 x214 OR STEVE MULLEN AT x215.

